MITSUBISHI MOTOR SALES OF AMERICA, Inc.

TECHNICAL SERVICE BULLETIN

SUBJECT:

MONTERO V6 OIL CAPACITY

NO. TSB-89-12-001
DATE June, 1989
MODEL Montero V6

TSB Revision TSB-89-12-001

PURPOSE

This bulletin describes a change in the stated oil capacity for the V6 engine in the 1989 Montero Service Manual. As a reference to this bulletin, please make the changes shown and write the TSB number in the TSB Revision box at the bottom of the affected pages.

T 1/28/89

AFFECTED SERVICE MANUAL

1989 Montero Service Manual Volume 1, Pages 0-7, 0-21

SERVICE MANUAL CORRECTIONS

Page 0-7

LUBRICANT CAPACITIES TABLE

Description	<2.6L Engine>		<3.0L Engine>	
	Metric measure	U.S. measure	Metric measure	U.S. measure
Engine oil			Includes filter	
Crankcase (except for oil filter)	4.9 liters	5.0 qts.	4.71 liters	5.0 qts.
Oil filter	0.4 liter	1/2 qt.	0.4 liter	1/2 qt.
Oil cooler	–	–	0.3 liter	1/2 qt.

Page 0-21

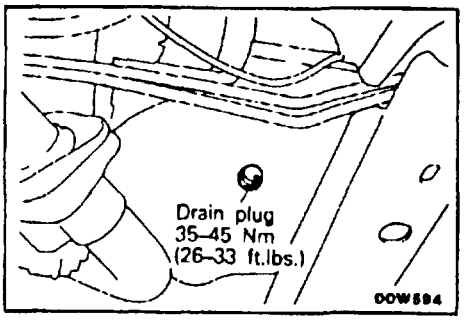

(1) After warming up the engine, remove the oil filler cap.
(2) Remove the drain plug to allow the engine oil to drain.
(3) Replace the drain plug gasket with a new one and tighten the drain plug.
(4) Supply new engine oil through the oil filler.

Engine oil total capacity:
<2.6L Engine> add 1/2qt. filter **4.9 liters (5.0 qts.)**
<3.0L Engine> includes filter **4.7 liters (5.0 qts.)**
~~**(including oil filter 0.4 liter (1/2 qt.))**~~

(5) Start and run the engine a few minutes.
(6) Stop the engine and check the engine oil level.

015253

FILE UNDER: Group 12 Lubrication in the Dealer Service Information Binder.

CIRCULATE TO: ☐ GENERAL MANAGER ☐ PARTS MANAGER ☐ TECHNICIAN ☐ SERVICE ADVISOR ☐ SERVICE MANAGER ☐ WARRANTY PROCESSOR ☐ SALES MANAGER

(695)